Blue

Work Order ID 53274

October 30, 2009 1:37:08 PM

Item ID: D206-667-203BL **Accept** **Setup Start** **Stop**

Revision ID:

Item Name: Crosstube Aft, Blue

Start Date: 29/10/2009 **Start Qty:** 1.00 **Cust Item ID:**

Required Date: 09/11/2009 **Req'd Qty:** 1.00 **Customer:**

Reference:

Approvals: **Process Plan:** AC **Date:** 09-10-30 **Tooling:** _____ **Date:** _____ **Run Start** **Stop**

QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	**Revision Nbr**								
100		0.00							
DC	DOCUMENT CONTROL								
Document Control	**Memo** Photocopy bluefile and create labels as per PPP D206-667-203 CHG003	0.00							
110		0.00							
CNC Bend 2	BENDING MACHINE - CROSSTUBES								
CNC Alpha 160 Bender	**Memo** Bend tube as per Dwg D206-667-243 using CNC bender program 206L-AF and Folio FT_____	0.00							
120	QC15- Crosstube Dimensional Check	0.00							
QC									
Quality Control	**Memo**	0.00							

BS32744 D206-667-203

Work Order ID 53274

October 30, 2009 1:37:08 PM

Item ID: D206-667-203BL **Accept** **Setup Start** **Stop**

Revision ID:

Item Name: Crosstube Aft, Blue

Start Date: 29/10/2009 **Start Qty:** 1.00 **Cust Item ID:**

Required Date: 09/11/2009 **Req'd Qty:** 1.00 **Customer:**

Reference:

Run Start **Stop**

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130		0.00							
Crosstubes	Crosstubes								
Crosstubes	**Memo**	0.00							

Crosstubes

1-Drill pilot holes in tube using drill Jig DT8583 & DT8584 as per Dwg D206-667-243. Drill all (3) top holes.

2-Drill and Ream all holes in tube to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-243 Check dimensions between holes on all four sides.

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate Jigs off existing holes using "T" pins.

4-Drill pilot holes using drill Jig DT8583 & DT8584 as per Dwg D206-667-243. Drill only the top (2) holes.

5-Drill & ream the top (2) holes to finish size using drill Jig DT8583 & DT8584 as per Dwg D206-667-243

6-Drill Fwd rivet holes using drill Jig DT8789FWD as per Dwg D206-667-143.Note: Fwd side has 3x top holes.

7-Drill Aft rivet holes using drill Jig DT8789 as per Dwg D206-667-243.

8-C'sink holes as per Dwg D206-667-243.

9 -Scribe part # and batch # using vibrating stylus as per Dwg D206-667-243 Inside of Cuff(Donot engrave on outside of tube)

10 -Deburr & Inspect for surface damage. Repair damage within limits as per Dwg

MB 09-11-25

HWM 9-11-25

Work Order ID 53274

October 30, 2009 1:37:08 PM

Item ID: D206-667-203BL **Accept** **Setup Start** **Stop**

Revision ID:

Item Name: Crosstube Aft, Blue

Start Date: 29/10/2009 **Start Qty:** 1.00 **Cust Item ID:**

Required Date: 09/11/2009 **Req'd Qty:** 1.00 **Customer:**

Reference:

Run Start **Stop**

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
	D206-667-243								
140	Crosstubes Chemical Conversion	0.00				1	—	— AWM 9-1-25	
HandFXtube	**Memo**	0.00							
Hand Finishing Crosstubes									
150	QC3- Inspect Part Finish	0.00							
QC	**Memo**	0.00							
Quality Control									
160	QC5- Inspect part completeness to step on W/O	0.00							
QC	**Memo**	0.00							
Quality Control									

=7 8 oc/u/26

=7 8 oc/u/26

Work Order ID 53274

October 30, 2009 1:37:08 PM

Item ID: D206-667-203BL **Accept** **Setup Start**

Revision ID: **Stop**

Item Name: Crosstube Aft, Blue

Start Date: 29/10/2009 **Start Qty:** 1.00 **Cust Item ID:**

Required Date: 09/11/2009 **Req'd Qty:** 1.00 **Customer:**

Reference:

Run Start

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____ **Stop**

QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170	Outsource process - NDT per QSI038 4.1	0.00							
Outsource2	**Memo**	0.00							
Outsource process - NDT	Liquid Penetrant Inspection as per QSI 038Or Issue P/O: 10851 LPI as per ASTM 1417 Level 2 Attach copy of NDT results to work order								
180	Packaging	0.00							
Packaging	**Memo**	0.00							
Packaging	Ensure copy of NDT results attached to work order.								
190	QC5- Inspect part completeness to step on W/O	0.00							
QC	**Memo**	0.00							
Quality Control	Ensure results are as per Dwg D206-667-243								

Work Order ID 53274

October 30, 2009 1:37:08 PM

Item ID: D206-667-203BL **Accept** **Setup Start** **Stop**

Revision ID:

Item Name: Crosstube Aft, Blue

Start Date: 29/10/2009 **Start Qty:** 1.00 **Cust Item ID:**

Required Date: 09/11/2009 **Req'd Qty:** 1.00 **Customer:**

Reference:

Run Start **Stop**

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200		0.00							
SprayPaint	SprayPaint					M1	09	12	01 (1)
SprayPaint	**Memo**	0.00							
Spray Painting	PRIME GREY 110918 SPRAY PAINT DELFLEET BLUE 113171 CLEAR DELFLEET 110896								
210	QC14- Inspect Spray Paint	0.00							
QC						IT	09-12-02		
Quality Control	**Memo**	0.00							
	INSPECT SPRAY PAINT								
220		0.00							
Crosstubes	Crosstubes					M1	09	12	02 (1)
Crosstubes	**Memo**	0.00							
	1-Install nut plates as per Dwg D206-667-243.								

Work Order ID 53274

October 30, 2009 1:37:08 PM

Item ID: D206-667-203BL **Accept** **Setup Start** **Stop**

Revision ID:

Item Name: Crosstube Aft, Blue

Start Date: 29/10/2009 **Start Qty:** 1.00 **Cust Item ID:**

Required Date: 09/11/2009 **Req'd Qty:** 1.00 **Customer:**

Reference:

Run Start **Stop**

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
230	Skidtubes	0.00				MM	09	12	OZ (1)
Skidtubes	**Memo**	0.00							
Skidtubes	1-Install support using 0.03" to 0.06" thick layer of magnobond 6398 per QSI 015. Let cure for 12h after installation and prior to packaging. Note: (3) top holes should be facing up. A/R Magnobond 6398 : 1124/7 exp: 01/2011								
	2-Install supports and clamps as per Dwg D206-667-243. Torque clamps to 80-100 in lb								
240	QC5- Inspect part completeness to step on W/O	0.00				(4C)			
QC	**Memo**	0.00							
Quality Control									

=> Sor 12/03

Work Order ID 53274

October 30, 2009 1:37:08 PM

Item ID: D206-667-203BL **Accept** **Setup Start** **Stop**

Revision ID:

Item Name: Crosstube Aft, Blue

Start Date: 29/10/2009 **Start Qty:** 1.00 **Cust Item ID:**

Required Date: 09/11/2009 **Req'd Qty:** 1.00 **Customer:**

Reference:

Run Start **Stop**

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
250	Pick Kit	0.00				9/12/3		54	
Packaging	**Memo**	0.00							
Packaging									
260	QC4- 100% Inspect kits for completeness	0.00				⇒ 9/12/3			
QC	**Memo**	0.00				(0)	0		
Quality Control									
270		0.00							
Packaging	Packaging					9/12/3 (1)			
Packaging	**Memo**	0.00							
	Identify and pack for shipping as per PPP D206-667-203 Location: _____ PPP Rev: D								

Item ID: D206-667-203BL **Accept** **Setup Start** **Stop**
Revision ID:
Item Name: Crosstube Aft, Blue
Start Date: 29/10/2009 **Start Qty:** 1.00 **Cust Item ID:**
Required Date: 09/11/2009 **Req'd Qty:** 1.00 **Customer:**
Reference:

Run Start **Stop**

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____
QC: _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Draw Number	Draw Rev.	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
280	QC21- Final Inspection - Work Order Release	0.00				_____	09/12/03		
QC	**Memo**	0.00							
Quality Control									

W 29.12.03

Picklist Print

October 30, 2009 1:37:12 PM

Work Order ID: 53274

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Comments:

Start Date: 29/10/2009 **Required Date:** 09/11/2009

Start Qty: 1.00 **Required Qty:** 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
AN5-10A Bolt		Purchased	No				Each	153.0000	10.0000	9/12/13 SP		

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	153		
107013	8		
110363	2		
112314	26		
112385	50		8x SP
112805	17		
112933	50		2x SP

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
AN5-32A Bolt		Purchased	No				Each	147.0000	4.0000	9/12/13 SP		

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	147		
106242	3		
106519	4		
110363	17		
112082	23		
112805	50		4x SP
112933	50		

Picklist Print

October 30, 2009 1:37:12 PM

Work Order ID: 53274

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Comments:

Start Date: 29/10/2009 **Required Date:** 09/11/2009

Start Qty: 1.00 **Required Qty:** 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
AN5-34A		Purchased	No				Each	34.0000	4.0000			
Bolt												

9/12/12 SP

Warehouse Location	Loc Qty	Loc Code
Main Warehouse		
ST	34	
104679	2	
105408	1	1x
107013	2	
111425	29	3x

SP

Picklist Print

October 30, 2009 1:37:12 PM

Work Order ID: 53274

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Comments:

Start Date: 29/10/2009 **Required Date:** 09/11/2009

Start Qty: 1.00 **Required Qty:** 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
AN960JD516		Purchased	No				Each	1,560.000	18.0000			
Washer										9/10/13 SJ		

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	1560		
100564	2		
106167	6		
107534	34		
107959	43		
108246	46		
108672	2		
109059	49		
109752	22		
110363	46		
110523	57		
111279	39		
112082	68		
112314	500		
112794	146		
112828	500		18 X 50

D206-667-203TRNRevC		Manufactured	No				Each	0.0000	1.0000			
Crosstube Turning Detail										B-53416 MB 09-11-23		

Picklist Print

October 30, 2009 1:37:12 PM

Work Order ID: 53274

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Comments:

Start Date: 29/10/2009 **Required Date:** 09/11/2009

Start Qty: 1.00 **Required Qty:** 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D2873-043RevA		Manufactured	No				Each	41.0000	2.0000			
Nut Plate Assembly												

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	41		_____
45370	6		_____
45422	15		_____
50002	20		_____

ml 09 12 02

D2873-045RevA		Manufactured	No				Each	59.0000	2.0000			
Nut Plate Assembly												

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	59		_____
45210	3		_____
46772	16		_____
50001	40		_____

ml 09 12 02

Picklist Print

October 30, 2009 1:37:12 PM

Work Order ID: 53274

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Comments:

Start Date: 29/10/2009 **Required Date:** 09/11/2009

Start Qty: 1.00 **Required Qty:** 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
D2892-1RevA		Manufactured	No				Each	40.0000	2.0000			
Support												

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	40		
41986	16		
42785	20		
45936	4		

Blue
BS3348

ml 09 12 02

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
BLUE D3595-063-450RevA		Manufactured	No				Each	132.0278	4.0000			
RUBBER CUSHION												

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
LG	127.0589474		
50953	19.0589474		
52447	108		
Main Warehouse			
ST	4.9689		
38959	2		
43210	2.59		
46465	0.3789		

ml 09 12 02

Picklist Print

October 30, 2009 1:37:12 PM

Work Order ID: 53274

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Comments:

Start Date: 29/10/2009 **Required Date:** 09/11/2009

Start Qty: 1.00 **Required Qty:** 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
MS20601-AD4W10		Purchased	No				Each	185.0000	14.0000			
RIVET												

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	185		
110665	72		
111177	113		

nl 09 12 02

MS21042L5		Purchased	No				Each	1,060.000	4.0000			
Nut												

Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	1060		
110382	10		
111127	4		
111636	46		
112314	1000		

9/12/3 SP

9x SP

Picklist Print

October 30, 2009 1:37:12 PM

Work Order ID: 53274

Parent Item: D206-667-203BL

Parent Item Name: Crosstube Aft, Blue

Comments:

Start Date: 29/10/2009 **Required Date:** 09/11/2009

Start Qty: 1.00 **Required Qty:** 1.00

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Remaining Qty To Pick	Qty Issued	Date Issued	Status
MS21920-22		Purchased	No				Each	98.0000	4.0000			

Clamp(per MIL-DTL-8783C)


Warehouse Location	Loc Qty	Loc Code	
Main Warehouse			
ST	98		_____
109495	6		_____
110260	42		_____
111210	50		_____

ml 09 12 02

DART AEROSPACE LTD	Work Order:	53274
Description: Crosstube High Aft (206L)	Part Number:	D206-667-203
Inspection Dwg: D206-667-243 **Rev:** ~~B~~ C		Page 1 of 1

Required Dimension	Min	Max
Height	~~23.46~~ 23.31	~~23.58~~ 23.65
1/2 Span	~~41.86~~ 41.74	~~41.98~~ 42.05
Angle	54	56
Total Span	~~83.72~~ 82.58	~~83.96~~ 84.1

09.11.23

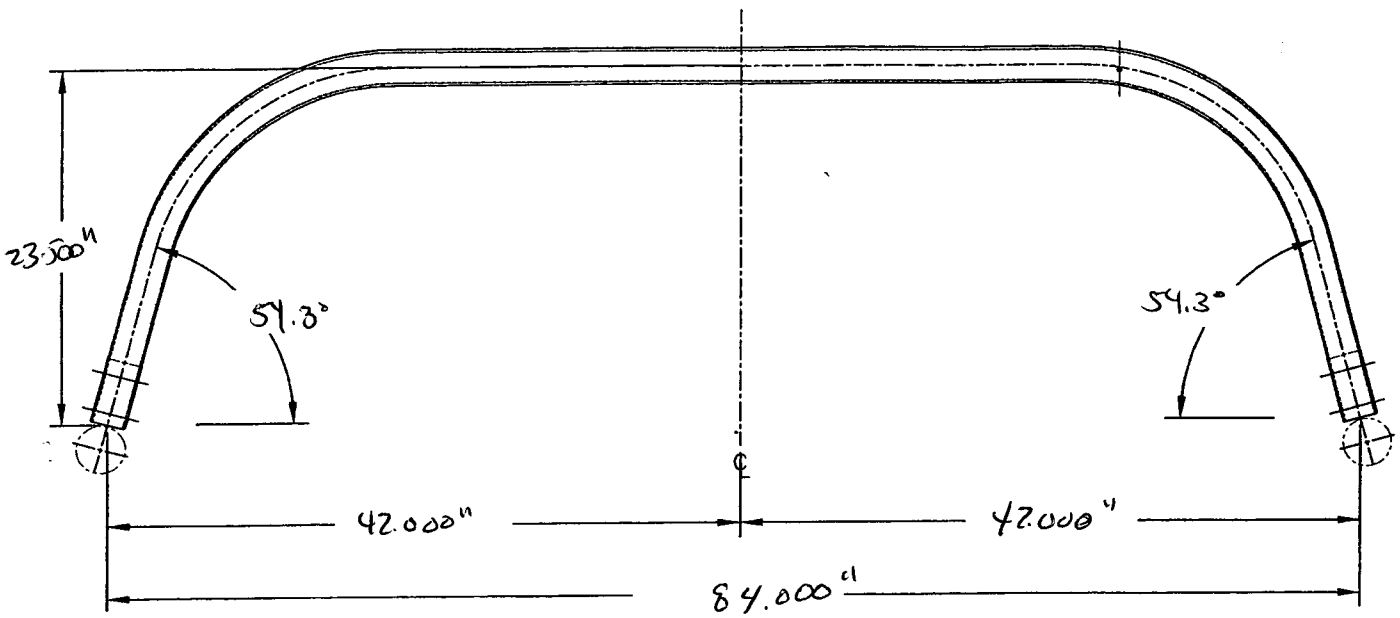

Comments

QC15 Inspection	
Date	09/11/24

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	**STEP**	**PROCEDURE CHANGE**	**By**	**Date**	**Qty**	**Approval** Chief Eng / Prod Mgr	**Approval** QC Inspector

Part No: _____ **PAR #:** _____ **Fault Category:** _____ **NCR:** Yes No **DQA:** _____ **Date:** _____

Resolution: _____ **Disposition:** _____ **QA: N/C Closed:** _____ **Date:** _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	**STEP**	**Description of NC** Section A	**Corrective Action** Section B			**Verification** Section C	**Approval** Chief Eng	**Approval** QC Inspector
			Initial Chief Eng	**Action Description** Chief Eng	**Sign & Date**			

NOTE: Date & initial all entries

Item	Qty -243	Part Number	Description
1	X	D206-667-243	CROSSTUBE ASSEMBLY (206L HIGH AFT)
2	1	D6004-115	CROSSTUBE
3	2	D2873-043	NUT PLATE
4	2	D2873-045	NUT PLATE
5	2	D2892-1	SUPPORT
6	4	D3595-063-450	RUBBER CUSHION
7	4	MS21920-22	CLAMP
8	14	MS20601AD4W10	RIVET (OR NAS9302B-4-10)
9	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

SHOP COPY
RELEASED
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 53274

RELEASED 08/11/06

GENERAL NOTES:

1) MATERIAL: MANUFACTURED FROM D6004-115
 FINISHED LENGTH = 104.91±0.020
2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
 PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
 PAINT OUTSIDE PER DART QSI 005 4.2
3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
4) UNITS: INCHES UNLESS OTHERWISE NOTED.
5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
6) IDENTIFICATION: SCRIBE DART PART NUMBER "D206-667-243" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
7) WEIGHT: 21.9 lbs
8) PART IS SYMMETRIC ABOUT CENTERLINE.
9) RUN CUTTER OFF PART WHERE INDICATED. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
12) INSTALL D2892-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
13) INSTALL MS21920-22 CLAMPS WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2892-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMP MECHANISMS ARE LOCATED ON CROSSTUBE SUPPORTS.
14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS ARE SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.


REV.	DESCRIPTION	BY	DATE
C	REVISE GENERAL NOTES/PART LIST (ZN D7-1); REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS. D3595-063-450 WAS D2856-400-773 (ZN D6-2 & A5-2); REMOVED REF. & ADD TOLERANCES (ZN 4-3, C5-3, D3-3); RELOCATED FLAG #6 (ZN A8-3) PER NCR 210; MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4.	RF	08.11.06
B	ADD HOLES AND NUT PLATES FOR COMPATABILITY WITH BHT/AA SKUDTUBES	PH	05.07.26
A	NEW ISSUE	CP	00.11.17

DESIGN	QP	**DART AEROSPACE LTD** HAWKESBURY, ONTARIO, CANADA	
DRAWN	RF		
CHECKED		DRAWING NO.	REV. C
MFG. APPR.		D206-667-243	SHEET 1 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (206L HIGH AFT)	NTS
DATE	08.11.06		


COPYRIGHT © 2006 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 53274


RELEASED
08/11/12 NP

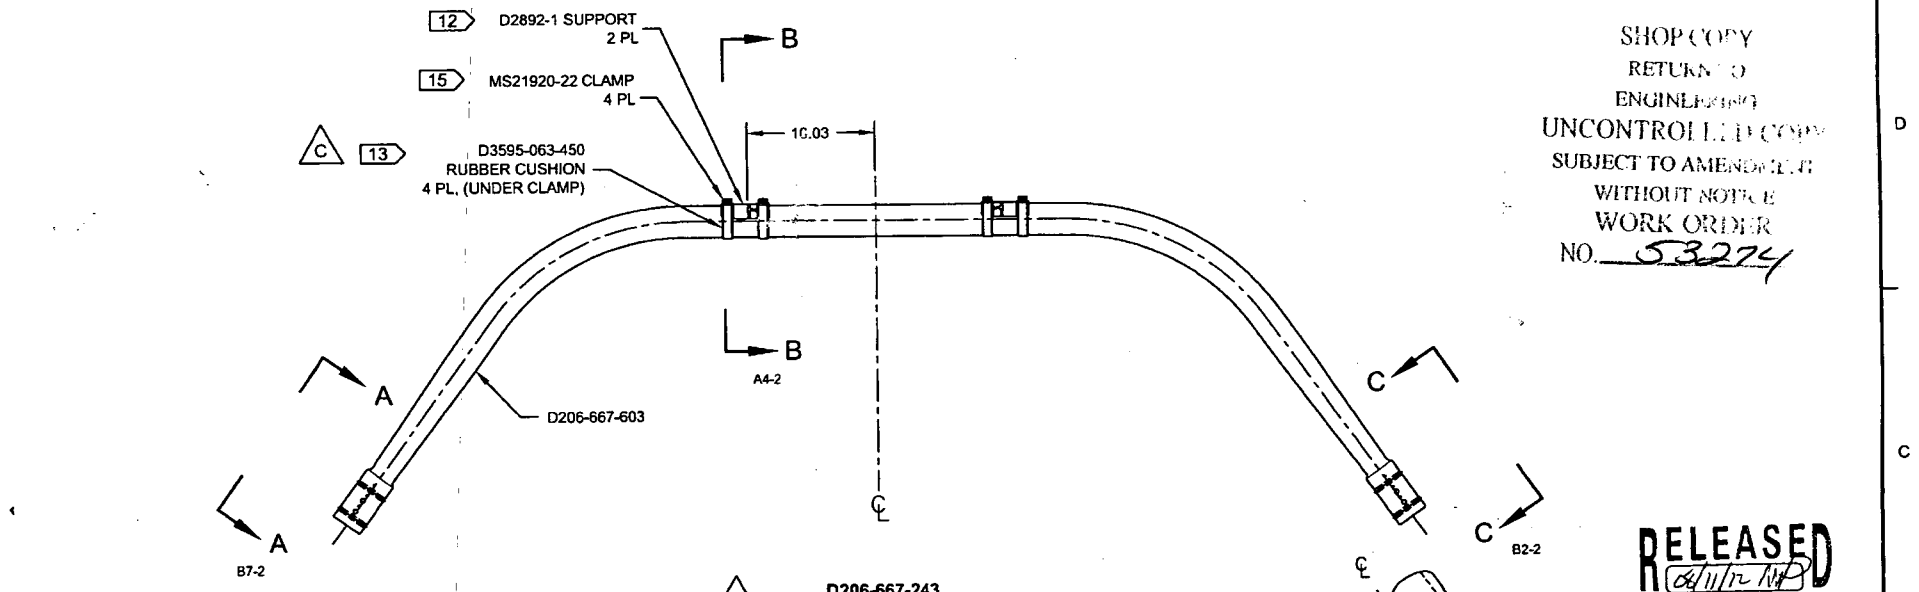


C **D206-667-243 ASSEMBLY DETAIL**
(VIEW LOOKING FWD)

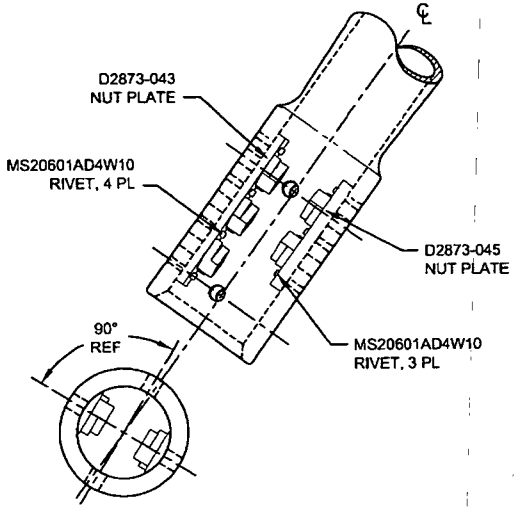

VIEW A-A:
C7-2 **CUFF DETAIL**
SCALE 4X

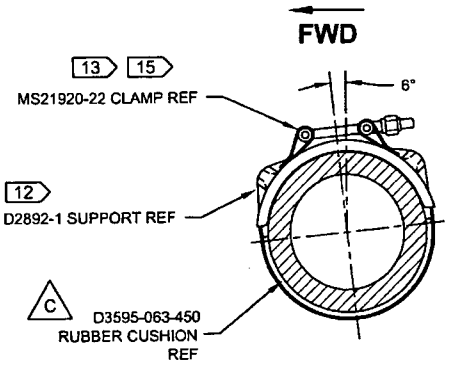

D5-2 **SECTION B-B**
SCALE 5X

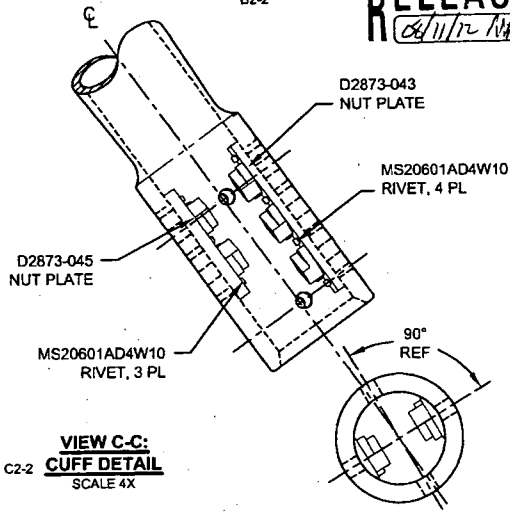


VIEW C-C:
C2-2 **CUFF DETAIL**
SCALE 4X

DESIGN		**DART AEROSPACE LTD** HAWKESBURY, ONTARIO, CANADA
DRAWN	RF	
CHECKED		DRAWING NO. REV. C
MFG. APPR.		D206-667-243 SHEET 2 OF 4
APPROVED		TITLE SCALE
DE APPR.		CROSSTUBE ASS'Y (206L HIGH AFT) NTS
DATE	08.11.06	

COPYRIGHT © 2000 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

SHOP COPY
RETURN TO
ENGINEERING


UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 53274

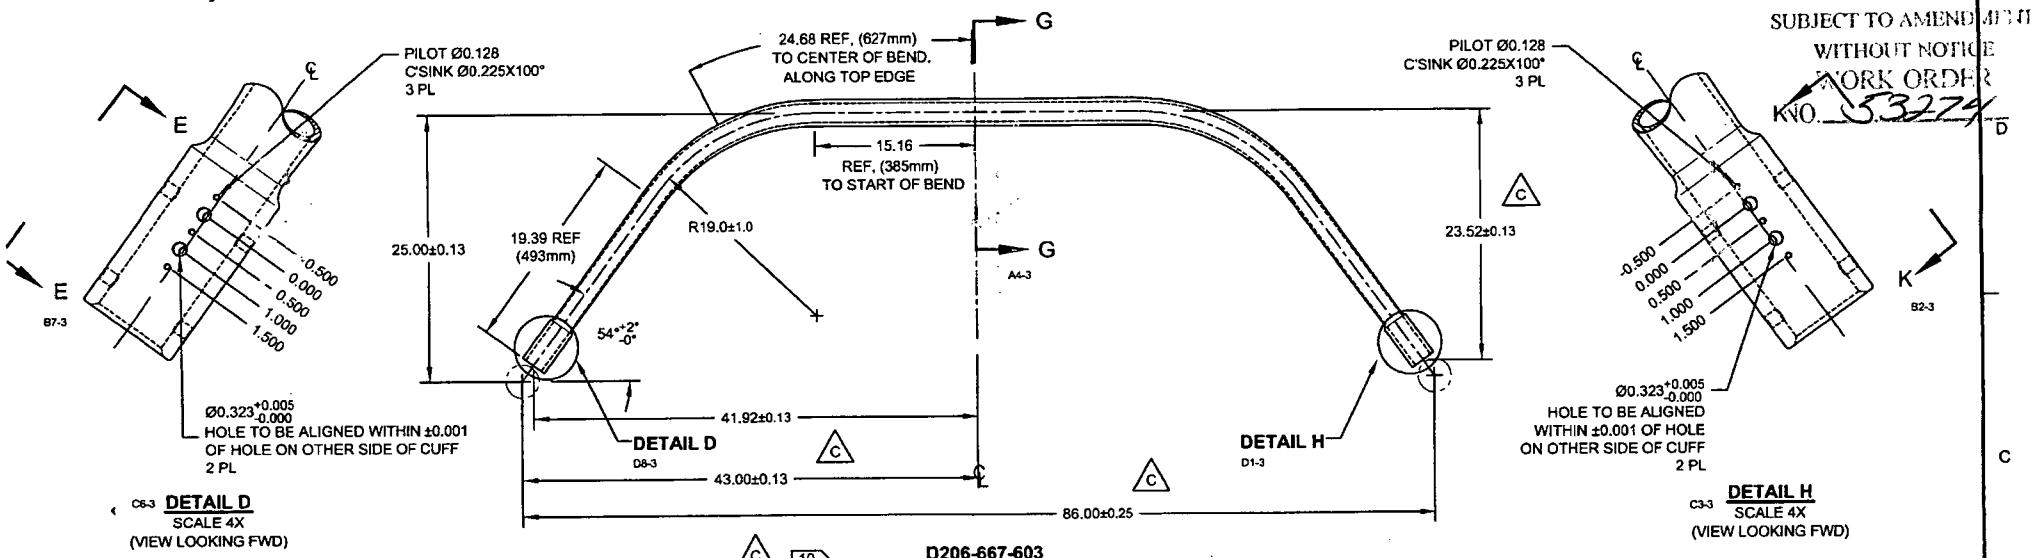


C6-3 **DETAIL D**
SCALE 4X
(VIEW LOOKING FWD)

C3-3 **DETAIL H**
SCALE 4X
(VIEW LOOKING FWD)


D206-667-603
BENDING AND DRILLING DETAIL
(VIEW LOOKING FWD)

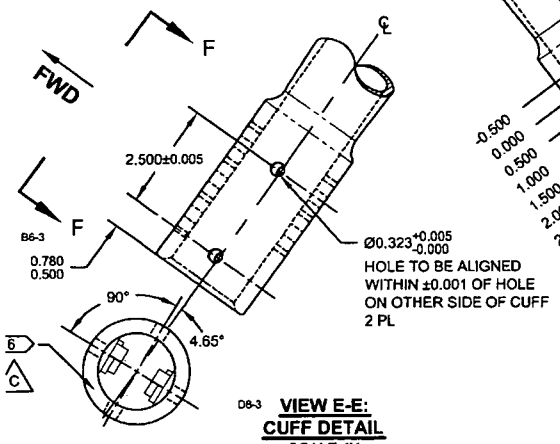


D8-3 **VIEW E-E:**
CUFF DETAIL
SCALE 4X

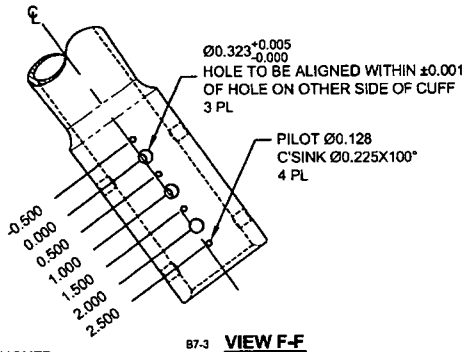


B7-3 **VIEW F-F**
(VIEW LOOKING AFT, ROTATED)

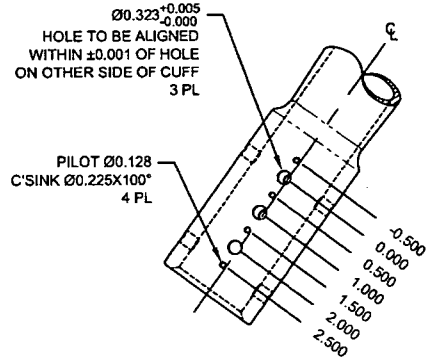

B2-3 **VIEW J-J**
(VIEW LOOKING AFT, ROTATED)

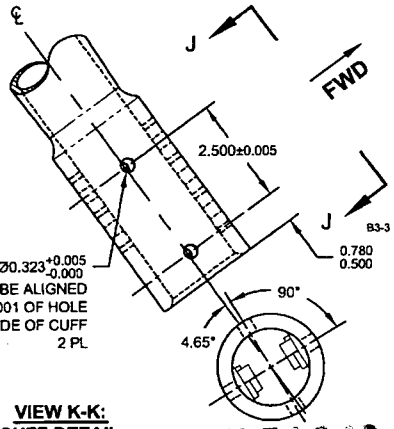

D1-3 **VIEW K-K:**
CUFF DETAIL
SCALE 4X

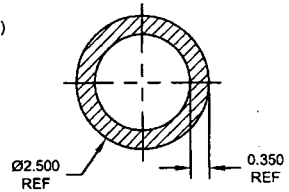


D4-3 **SECTION G-G**
SCALE 5X

RELEASED
08/11/12


DESIGN		**DART AEROSPACE LTD** HAWKESBURY, ONTARIO, CANADA
DRAWN	RF	
CHECKED		DRAWING NO. D206-667-243 REV. C SHEET 3 OF 4
MFG. APPR.		
APPROVED		TITLE CROSSTUBE ASS'Y (206L HIGH AFT) SCALE NTS
DE APPR.		
DATE 08.11.06		

COPYRIGHT © 2000 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD


STOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 53274

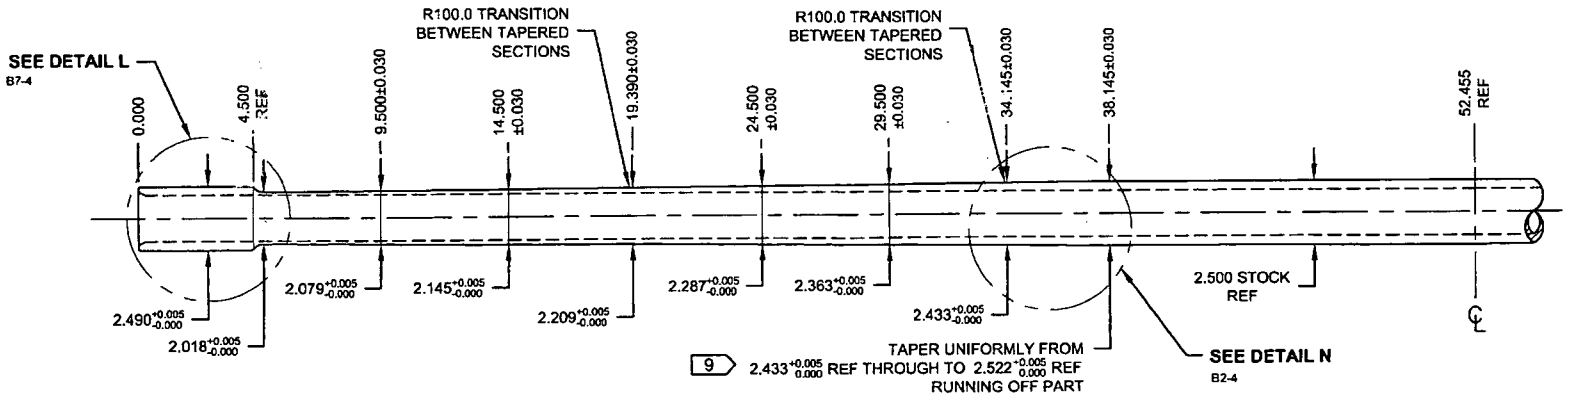


C **TURNING DETAIL**

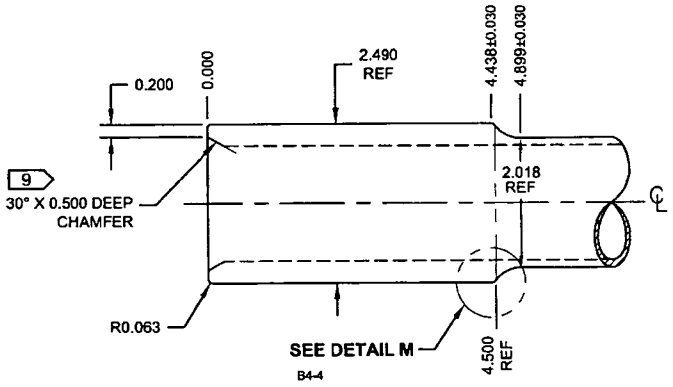

C7-4 **DETAIL L: CROSSTUBE CUFF**
NOT TO SCALE

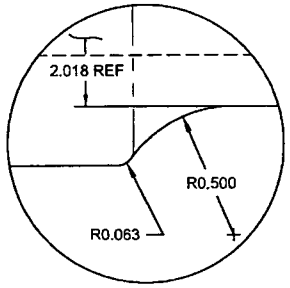

DETAIL M:
B6-4 **CUFF TRANSITION**
NOT TO SCALE

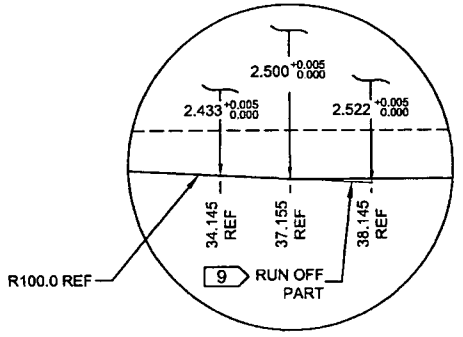

DETAIL N:
C4-4 **TAPER RUN-OFF**
NOT TO SCALE

RELEASED
08/11/12

DESIGN		**DART AEROSPACE LTD** HAWKESBURY, ONTARIO, CANADA
DRAWN	RF	
CHECKED		DRAWING NO. D206-667-243 REV. C SHEET 4 OF 4
MFG. APPR.		
APPROVED		TITLE CROSSTUBE ASS'Y (206L HIGH AFT) SCALE NTS
DE APPR.		
DATE 08.11.06		

COPYRIGHT © 2006 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

5.0 PARTS LIST 53274

Item	Qty -011	Qty -013	Qty -015	Qty -101	Qty -201	Qty -103	Qty -203	Qty -105	Qty -205	Part Number	Description
	X									D206-667-011	SPACER BLOCK KIT
		X								D206-667-013	NUT PLATE KIT (-101/-103/-105/-203/-205)
			X							D206-667-015	NUT PLATE KIT (-201)
				X						D206-667-101	CROSSTUBE INSTALLATION, 206A/B HIGH FWD
					X					D206-667-201	CROSSTUBE INSTALLATION, 206A/B HIGH AFT
						X				D206-667-103	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH FWD
							X			D206-667-203	CROSSTUBE INSTALLATION, 206L/L-1/L-3/L-4 HIGH AFT
								X		D407-667-105	CROSSTUBE INSTALLATION, 407 HIGH FWD
									X	D407-667-205	CROSSTUBE INSTALLATION, 407 HIGH AFT
1				1						D206-667-141	CROSSTUBE ASSEMBLY, 206A/B HIGH FWD
2					1					D206-667-241	CROSSTUBE ASSEMBLY, 206A/B HIGH AFT
3						1				D206-667-143	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH FWD
4							1			D206-667-243	CROSSTUBE ASSEMBLY, 206L/L-1/L-3/L-4 HIGH AFT
5								1		D407-667-145	CROSSTUBE ASSEMBLY, 407 HIGH FWD
6									1	D407-667-245	CROSSTUBE ASSEMBLY, 407 HIGH AFT
10				*2	*2	*2		*2		D2891-1	SUPPORT
11							*2			D2892-1	SUPPORT
12									*1	D2894-1	SUPPORT
13				*2	*2	*2		*2		D2856-400-694	ABRASION STRIP
14							*2		*2	D2856-400-773	ABRASION STRIP
15									*1	D2856-600-851	ABRASION STRIP
16				*4	*4	*4		*4		MS21920-20	CLAMP
17							*4		*4	MS21920-22	CLAMP
18									*2	MS21920-24	CLAMP
19				4	4	4		4		AN5-32A	BOLT
20							4		4	AN5-34A	BOLT
21				4	4	4	4	4	4	MS21042L5	NUT (OR MS21042-5)
22				8	8	8	8	8	8	AN960JD516	WASHER
23									*2	D3190-1	CHAFING SHIELD
30	8									AN4-6A	BOLT
31	8									AN4-7A	BOLT
32	16									AN960JD416	WASHER
33	2									D3193-041	SPACER BLOCK ASSEMBLY
40		2		*2		*2	*2	*2	*2	D2873-043	NUT PLATE
41		2		*2		*2	*2	*2	*2	D2873-045	NUT PLATE
42			2		2					D2872-043	NUT PLATE
43			2		2					D2872-045	NUT PLATE
44		10		10		10				AN5-7A	BOLT
45		10	10		10		10	10	10	AN5-10A	BOLT
46		4	4	4	10	4		4		AN5-30A	BOLT
47		4					4		4	AN5-32A	BOLT
48		18	18	10	12	10	10	10	10	AN960JD516	WASHER
49		4	4		6					MS21042L5	NUT (OR MS21042-5)

*REFERENCE ONLY. PARTS ARE INCLUDED IN D206-667-141/241/143/243, & D407-667-145/245 ASSEMBLIES ABOVE

• COPYRIGHT © 2001 BY DART AEROSPACE LTD •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

ACUREN

LIQUID PENETRANT TEST REPORT

P- 1531

PAGE 1 OF

CLIENT DRT AEROSPACE
ATTENTION LINDA - CHANTEL
ADDRESS 1270 ABERDEEN ST.
HAWKESBURY ON.
K6A 1K7
PROJECT F. P. I. ON CROSS TUBES
ITEM(S) EXAMINED 4 PCS

DATE NOV - 27 - 2009 TIME AM ☑ P
ACUREN JOB NO. 188-09-001643
PO/WO NO. — 10857
WORK LOCATION SHOP
ACCEPTANCE STD. ASTM 1417 REV./DATE 200

JOB DESCRIPTION | PROCEDURE NO. LT-02 REV./DATE | TECHNIQUE NO. LT-TECH 2 REV./DATE

PART NO. — MATERIAL ALUMINE ALUMINUM THICKNESS —
SCOPE WET FLUORESCENT LIQUID PENETRANT INSPECTION CARRIED OUT 100% EXTERNAL

TEST DETAILS

METHOD	☑ FLUORESCENT	☐ VISIBLE			☑ WATER WASH	☐ SOLVENT REMOVABLE	☐ POST EMU
FAMILY BRAND	MAGNAFLUX				BLACK LIGHT S/N 16459	☑ OUTPUT > 1000 µ W/CM²	☐ AMBIENT <
PENETRANT	2607	MINIMUM DWELL TIME	45/10	MIN.	LIGHTING EQUIP.	☐ FLASHLIGHT ☐ TROUBLELIGHT	☐ OUTPUT>100 fc @
PENETRANT REMOVER	1120	MINIMUM DRY TIME	>10	MIN.	OTHER		
DEVELOPER	SKD 52	MINIMUM DWELL TIME	10	MIN.	LIGHT METER S/N 1098866	CAL DUE DATE 10-	
DEVELOPER TYPE	☑ NON AQUEOUS	☐ AQUEOUS	☐ DRY				

TEST SURFACE

SURFACE CONDITION	☐ AS GROUND	☐ AS WELDED	☑ MACHINED	☐ SHOT BLASTED	☐ CLEAN BARE ME
SURFACE TEMPERATURE	☐ < - 4°C/ 20°F	☐ - 4°C/ 20°F TO 10°C/50°F		☑ 10°C/50°F TO 52°C/125°F	☐ > 52°C/125°F

RESULTS- (☐ METRIC ☐ IMPERIAL)

1 CROSS TUBE W.O. 53273 ✓

1 CROSS TUBE W.O. 53274 ✓

09 12 01

Scope of Services
The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be c representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care
In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expr implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE Dan Tilley (PRINT) (SIGNATURE)
TECHNICIAN (SIGNATURE):
NAME (PRINT): MIKE JOHNSTON (1ST TECHNICIAN) (2ND TECHNICIAN)
CGSB LEVEL II SNT LEVEL II CGSB LEVEL SNT LEVEL
CGSB REG. NO 60666 CGSB REG. NO

DTR # E-27681

REPORT REVIEWED BY:
NAME INIT

WHITE – CLIENT COPY CANARY – OFFICE COPY PINK – TECHNICIAN COPY GOLD – OFFICE COPY

PT